

Aluminum Baseboard with Cove Bend

Installation Instructions

- The wall surface where the baseboard is being installed must be dry and clean. Remove any dirt, dust, or loose paint.
- Set a laser or chalk line at the desired height measuring from the highest point of the floor.
- Begin installation at an inside corner or termination. Measure and cut baseboards to length for each wall. Dry fit the cut lengths on the wall to ensure proper installation. Clean field-cut edges as necessary.
- Utilize factory edges at butt seams and pre-fabricated outside corners to wrap corners. Baseboards are typically notched in the field and butt together at inside corners - pre-fabricated inside corners available upon request.
- Caulk any gaps created by unlevel floors. If floors are severely unlevel, an alternate baseboard product that can be scribed to the floor may be required.
- Adhesive installation - apply the adhesive to the back of the baseboard or baseboard corner. Place beads of adhesive 2 inches away from the perimeter edges and across the width of the material every 8-12 inches. Press the baseboards in place by hand, and then run a heavy pressure roller back and forth across the baseboard to make sure there is strong adhesion between the substrate and the baseboard. Allow 24-48 hours for the adhesive to cure. Additional bracing can be used to prevent movement once the baseboards are in place.
- Screw-On installation - Consult factory for hole spacing. Pre-drilled holes are available, but only recommended for walls with continuous backing.

Important

1. Acclimate materials to the installation environment for 24 hours prior to installation. Maintain a temperature controlled environment during and after installation.
2. To cut the material, use fine tooth aluminum cutting blades. Use a circular saw with straight edge as a guide to make straight cuts. Jigsaws can be used for smaller cut-outs. Make sure that material is secure and that cuts are made on flat surfaces to ensure a clean cut.
3. To drill the material, any high-speed steel, titanium or cobalt twist bit will work. Clamp the item securely. Use a punch and hammer to make a dimple where the hole is to be drilled. This will keep the drill bit from wandering.

DISCLAIMER: Please read all instructions before beginning installation. These guidelines are provided in good faith to help prevent any problems caused by errors in installation. The manufacturer of this product shall not be held responsible for installation actions taken or not taken. There are many details of installation that are assumed to be general construction knowledge to experienced installers; which are not included in these instructions. These installation guidelines are intended to be strictly recommendations and are not to serve as a step-by-step, fail-safe installation checklist. Selection of an experienced installer is the sole responsibility of the project owner and architect. Protek Systems, Inc. does not accept any responsibility for job failure resulting from or associated with improper site environmental conditions and installation failure due to expansion contraction issues.